FiberMaxä Module

FMXL658-060-XXXA/B/G 658nm, 60mW



Description

FiberMax single-mode fiber-pigtailed laser modules deliver superior performance for today's demanding electro-optic applications. Based on Blue Sky Research CircuLaserTM technology, the FiberMax package provides the highest fiber output power level achieved from its laser diode source by any commercially available single-mode fiber-pigtailed package. Using a unique Blue Sky Research package design, FiberMax outputs are amongst the most thermally stable available. The FiberMax line offers a wide range of wavelengths and power levels to fit customer requirements. In addition the units are offered with PM fiber, 3mm jacketing, and a range of collimator options. FiberMax fiber-coupled modules are competitively priced and backed by Blue Sky Research customer support. The FMXL is available in three different pin-outs of which two have PD monitors.



Optical and Electrical Characteristics*

| Item | Symbol | Unit | Min | Тур | Max | Test Condition |
|--------------------------|-----------------------------|------|-----|-----|-----|---------------------------------------|
| Optical output power | Po | mW | 60 | 70 | | Tc=25°C |
| Threshold current | $I_{\scriptscriptstyle TH}$ | mA | | | 80 | Tc=25°C |
| Operating current | I_{OP} | mA | | | 190 | Tc=25°C |
| Operating voltage | V _{OP} | V | 2.0 | 2.4 | 3.0 | Tc=25°C |
| Lasing wavelength | λ | nm | 654 | 658 | 662 | Tc=25°C |
| Monitor Current – A Pkg. | $I_{\scriptscriptstyle M}$ | mA | 1.5 | 2.2 | 3.0 | $Po = 60 \text{mW}, V_R = 5 \text{V}$ |
| Monitor Current – B Pkg. | $I_{\scriptscriptstyle M}$ | mA | 0.8 | 1.5 | 2.0 | $Po = 60 \text{mW}, V_R = 5 \text{V}$ |

Absolute Maximum Rating

| Item | Symbol | Unit | Min | Max | Test Condition |
|-----------------------|---------------------|------|-----|-----|----------------|
| Operating temperature | T_{OPR} | °C | -10 | +50 | |
| Storage temperature | T_{stg} | °C | -40 | +85 | |
| LD reverse voltage | V_{R} (LD) | V | | 2 | Tc=25°C |
| PD reverse voltage | V _R (PD) | V | | 30 | Tc=25°C |

Fiber Specs

Single mode fiber w/3mm or 900um protective jacket

| Item | Symbol | Unit | Min | Тур | Max |
|-----------------------------|--------|-------|-----|------|-----|
| Fiber numerical aperture | NA | | | 0.13 | |
| Mode Field Diameter @ 630nm | MFD | um | 3.5 | 4.0 | 4.5 |
| Length | L | meter | - | 1 | - |

Polarization maintaining fiber w/ 3mm or 900um protective jacket

| Totalization maintaining meet will | mm or 700um | protective juck | | | |
|------------------------------------|-------------|-----------------|-----|------|-----|
| Item | Symbol | Unit | Min | Тур | Max |
| Fiber numerical aperture | NA | | | 0.11 | |
| Mode Field Diameter @ 630nm | MFD | um | 4.5 | 5.0 | 5.5 |
| Length | L | meter | - | 1 | - |

BSR 5/05

FiberMaxä Module





| FOIAITZAUOII EXUIICUOII KAUO FEK UB 1/ 20 | | PER | dB | 17 | 20 | |
|---|--|-----|----|----|----|--|
|---|--|-----|----|----|----|--|

Collimator Options

| Туре | M | N | P | Q |
|---|------|-------|-------|-------|
| Beam Diameter (1/e ² , mm, ±25%) | 0.8 | 1.3 | 1.9 | 3.2 |
| Divergence (mrad) | <1.2 | < 0.8 | < 0.5 | < 0.4 |

^{*}Specifications are subject to change without notice

. Ordering Information

| FMXL - 658-060 - Product Family S = single mode / 3mm jacket P = polarization maintaining / 3mm jacket T = single mode / 900 um jacket M = polarization maintaining / 900 um jacket Fiber Connector 0 = No connector F = FC/PC A=FC/APC S=SC/PC G=SC/APC R=Ferrule only Collimator None = 0 Or M, N, P, Q Pin-out Choose A, B, or G | |
|---|---------------------------------------|
| Fiber/Cable Type S = single mode / 3mm jacket P = polarization maintaining / 3mm jacket T = single mode / 900 um jacket M = polarization maintaining / 900 um jacket Fiber Connector 0 = No connector F = FC/PC A=FC/APC S=SC/PC G=SC/APC R=Ferrule only Collimator None = 0 Or M, N, P, Q Pin-out | FMXL - 658-060 - \Box |
| S = single mode / 3mm jacket P = polarization maintaining / 3mm jacket T = single mode / 900 um jacket M = polarization maintaining / 900 um jacket Fiber Connector 0 = No connector F = FC/PC A=FC/APC S=SC/PC G=SC/APC R=Ferrule only Collimator None = 0 Or M, N, P, Q Pin-out | Product Family |
| P = polarization maintaining / 3mm jacket T = single mode / 900 um jacket M = polarization maintaining / 900 um jacket Fiber Connector 0 = No connector F = FC/PC A=FC/APC S=SC/PC G=SC/APC R=Ferrule only Collimator None = 0 Or M, N, P, Q Pin-out | Fiber/Cable Type |
| T = single mode / 900 um jacket M = polarization maintaining / 900 um jacket Fiber Connector 0 = No connector F = FC/PC A=FC/APC S=SC/PC G=SC/APC R=Ferrule only Collimator None = 0 Or M, N, P, Q Pin-out | S = single mode / 3mm jacket |
| T = single mode / 900 um jacket M = polarization maintaining / 900 um jacket Fiber Connector 0 = No connector F = FC/PC A=FC/APC S=SC/PC G=SC/APC R=Ferrule only Collimator None = 0 Or M, N, P, Q Pin-out | |
| M = polarization maintaining / 900 um jacket Fiber Connector 0 = No connector F = FC/PC A=FC/APC S=SC/PC G=SC/APC R=Ferrule only Collimator None = 0 Or M, N, P, Q Pin-out | |
| Fiber Connector 0 = No connector F = FC/PC A=FC/APC S=SC/PC G=SC/APC R=Ferrule only Collimator None = 0 Or M, N, P, Q Pin-out | · · · · · · · · · · · · · · · · · · · |
| F = FC/PC A=FC/APC S=SC/PC G=SC/APC R=Ferrule only Collimator None = 0 Or M, N, P, Q Pin-out | |
| A=FC/APC S=SC/PC G=SC/APC R=Ferrule only Collimator None = 0 Or M, N, P, Q Pin-out | 0 = No connector |
| S=SC/PC G=SC/APC R=Ferrule only Collimator None = 0 Or M, N, P, Q Pin-out | F = FC/PC |
| G=SC/APC R=Ferrule only Collimator None = 0 Or M, N, P, Q Pin-out | A=FC/APC |
| R=Ferrule only Collimator None = 0 Or M, N, P, Q Pin-out | S=SC/PC |
| Collimator | G=SC/APC |
| Collimator | R=Ferrule only |
| Or M, N, P, Q Pin-out | • |
| Pin-out | None = 0 |
| Pin-out | Or M, N, P, Q |
| Choose A, B, or G | |
| | Choose A, B, or G |
| | |


Example: FMXL-0658-060-SF0G, FiberMAX658 $^{\mathrm{TM}}$ laser module with 658nm Laser diode, 60 mW power output, single mode fiber in 3mm jacketing, FC/PC connector, no collimated beam output optics, and G pin-out.

FiberMaxä Module

FMXL658-060-XXXA/B/G 658nm, 60mW




Mechanical Outline

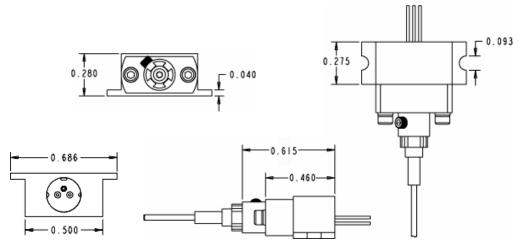

A Pinout

Case is cathode.





B Pinout

Case is anode.

G Pinout

Case is cathode.

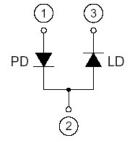



BSR 5/05

FiberMaxä Module FMXL658-060-XXXA/B/G 658nm, 60mW



Handling Care and Precautions for Use of FiberMax™ Modules

1. Absolute Maximum Ratings

Do not exceed, even momentarily, the maximum ratings (see page 1, table). When a FiberMax module is driven in excess of it's maximum ratings, it can cause at minimum a considerable reduction in reliability, and potentially instantaneous failure.

- a. FiberMax modules may be damaged by surge currents generated at power on-off operation. Check on the transient characteristics of the power supply to make sure that such surges do not exceed the maximum ratings.
- b. The maximum ratings are specified for a case temperature of 25°C. Designs should be made to work well within this temperature range. As the case temperature goes up, power dissipation as well as maximum light output power is reduced.

2. Soldering Conditions

Maximum solder-tip temperature is 260°C and soldering time must be within 3.0 seconds. A minimum solder clearance of 1.6mm should be maintained from the root of the lead.

3. Prevention of Breakdown due to Static Electricity

FiberMax modules may be adversely affected by static electricity and surge currents and, consequently, cause breakdown of the module and reduction of reliability unless the following precautions are taken:

- a. Power supplies, installation and measuring equipment should be grounded. A noise filter or noise-cut transformer should be provided on any power supply inputs.
- b. Anyone working with a FiberMax module should be grounded through high resistance (500 K Ohm 1M Ohm) by means of a ground strap and wrist band (for example).
- c. Soldering irons should be grounded to protect laser modules from voltage leaks.
- d. During operation of the FiberMax module, working clothes, hats, and shoes should be static-protected. Cotton-based clothing is preferred.
- e. Any container for carriage and storage should be static-protected.
- f. Avoid using laser modules in an environment where high frequency surge currents may be generated by an inductive electric field (such as a fluorescent lamp). These fields can also cause breakdown or deterioration of the laser module.
- 4. Package Handling
- a. The laser module package should not be cut off, reworked, or deformed. Care should be taken when handling the fiber to avoid kinking it.
- b. Do not touch the ferrule end. Any scratch or contamination may result in reduction of optical characteristics.
- c. Remove small contaminates on the ferrule surface carefully using a soft cotton tip stick with a small amount of methyl alcohol.
- 5. Safety

The output light from laser modules is harmful to a human body even if it is invisible. Avoid looking at the output light of a FiberMax module directly, or even indirectly through a lens during operation. Observance of operation should be through an infrared TV camera or related equipment. Refer to IEC 825-1 and 21 CFR 1040.10-1040.11 as a radiation safety standard for laser products.

LASER DIODE



AVOID EXPOSURE

visible Laser Radiation is emitted from this aperture

